



## OJ-Air AHC-3000-X Software 1.00 - 1.03

Software upgrade from versions 1.00, 1.01, 1.02 and 1.03 must be made in two steps.

### Software upgrade steps

Old AHC-3000-X controllers can't be upgraded to the latest software in one step. If e.g. an upgrade is attempted from SW 1.00 to 1.11 the controller will stop working. The LED at terminals 45-46 will flash red and the controller must be returned to OJ Electronics for service. It is not possible to restore the old version using the PC-tool. The software update process has been slightly modified, and there are no issue in later versions.

Installed Software version...	Software upgrade steps...
SW 1.00 SW 1.01 SW 1.02 SW 1.03	1) Install sw 1.04 2) Install sw 1.11 or higher
SW 1.04 or higher	1) Install sw 1.11 or higher

### BasicBMS

The BasicBMS feature shall only be used on controllers having production code 17:xxxxx:xxxx:20 or higher.

Please see product information no. 603 for details.

Production code...	Software version...	BasicBMS
16:xxxxx:xxxx:20 or lower	1.10 or higher	Shall not be used
17:xxxxx:xxxx:20 or higher	1.10 or higher	Can be used

### Affected articles

- AHC-3000-T
- AHC-3000-B
- AHC-3000-S

### Coming into force

Version 1.11 was released in week 17 2020.

Please see product information no. 614 for details.

### Contact

If further technical information is required please contact our support dept.: [support@oj.dk](mailto:support@oj.dk).