



OJ-Air AHC-3000 Software upgrade from old versions to 1.33

Software upgrade from versions older versions than 1.20 must be made in steps.

Software upgrade steps

Old AHC-3000-X controllers can't be upgraded to the latest software in one step. If e.g. an upgrade is attempted from SW 1.00 to 1.11 the controller will stop working. The LED at terminals 45-46 will flash red and the controller must be returned to OJ Electronics for service. It is not possible to restore the old version using the PC-tool. The software update process has been slightly modified, and there are no issue in latest versions.

Installed Software version...	Software upgrade steps...
SW 1.00,1.01,1.02,1.03	<ol style="list-style-type: none"> 1) Install sw 1.04 2) Install sw 1.11 3) Install sw 1.20 4) Install sw 1.33
SW 1.04,1.05,1.06	<ol style="list-style-type: none"> 1) Install sw 1.11 2) Install sw 1.20 3) Install sw 1.33
SW 1.10, 1.11	<ol style="list-style-type: none"> 1) Install sw 1.20 2) Install sw 1.33
SW 1.20,1.21,1.22 SW 1.30, 1.31, 1.32	<ol style="list-style-type: none"> 1) Install sw 1.33

BasicBMS

The BasicBMS feature shall only be used on controllers having production code 17:xxxxx:xxxx:20 or higher.

Please see product information no. 603 for details.

Production code...	Software version...	BasicBMS
16:xxxxx:xxxx:20 or lower	1.10 or higher	Shall not be used
17:xxxxx:xxxx:20 or higher	1.10 or higher	Can be used

Affected articles

- AHC-3000-T
- AHC-3000-B
- AHC-3000-S

Contact

If further technical information is required please contact our support dept.: support@oj.dk.